

Investigation report

Gustav Gerster GmbH & Co. KG

Memminger Straße 18

88400 Biberach/Riss

DELCOTEX
Delius Techtex GmbH & Co. KG
Vilsendorfer Str. 50
33739 Bielefeld
Germany

Internet - homepage: www.textillabor.eu

Kontakt- contact: Dragana Vinc
Abteilung - division: Labor/Laboratory
Telefon - phone: +49 (0) 52 1 / 543 - 539

Datum - date : 25.09.2024

Investigation report No. 24/2792

Order description:	Proof of flammability to classify building materials to class B1 „schwerentflammbar“ according to DIN 4102, part 1 Fire behaviour of building materials and building components Part 16: Performance of fire shaft tests according to DIN 4102-16 (2021-01)
Test samples:	article: „7485/300/0001, 100% Polyester “ „7485/300/0010, 100% Polyester “
Sampling:	by the client
Orderer:	see address
Date of order:	28.08.2024
Receipt of order:	29.08.2024
Date of testing:	12.09.2024
Number of pages:	9

Remark: The results are valid only for the tested object. Accredited test methods are underlined. The valuations and Interpretations in the investigation report are not subject to accreditation. Tests conducted through co-operation partners are marked with °. All information provided by the customer, which is taken over unchecked and thus reflected in the examination report, are placed in quotation marks on the first page of the investigation report. Changes to the original investigation report are marked with a vertical line in the left side edge and a revision level is added to the investigation report number. The content of this investigation report will not be passed to third persons without written approval of the orderer. The partial publication of the test report, as well as the usage for commercial process, is only allowed with a permission of the DELCOTEX Delius Techtex GmbH & Co. KG. Remnants of test material will be destroyed after 3 months. Previously stated specifications / data sheets / certificates are only characters and no warranties. Also no warranty in case of durability will be overtaken. Finally our general delivery and payment conditions are valid (please see www.textillabor.eu).

Investigation report No. 24/2792

page 2 of 6

Test results

Description of test material in condition as delivered

Name of the material	Description of samples	Colour	thickness [mm]	weight [g/m ²]
Customer details: „7485/300/0001; 7485/300/0010“	Both articles: Material: 100% polyester	0001 0010		
addition D-LAB:	woven fabric; plain weave; curtain no difference between the fabric sides	white	≈0,16 ≈0,15	≈ 48,98 ≈ 50,36

The testing laboratory is not provided with further details concerning composition of the tested building materials.

Preparation of samples:

Out of the material there have been cut samples with the dimensions of 1000mm x 190mm to flame impingement for the ignitability apparatus.

The samples were kept in climate chamber 20 +/- 2 °C and 65 +/- 4 humidity until they reached constant weight.

Special remarks: -

Investigation report No. 24/2792

page 3 of 9

Test results

1. Method: "Brandschacht" test accordance to DIN 4102 (1998-05)

"Brandschacht" tests (Part 1)

Arrangement of samples: freely suspended

Sample A	flaming side A in lenght direction	colour: 0001	4 samples lenght side A
Sample B	flaming side A in cross direction	colour: 0001	4 samples cross side A
Sample C	flaming side A in lenght direction	colour: 0001	4 samples lenght side A

		Result with the tested specimen					
		Dim.	A	B	C		
1	Number of specimen arrangement acc. to. DIN 4102/T15 (1990-05), schedule 1		1	1	1		
2	Maximum flame height above bottom edge of the specimen	cm	30	30	30		
3	Time ¹⁾	min:s	0:08	0:08	0:08		
4	Burn through / melting						
	Time ¹⁾	min:s	0:02	0:02	0:02		
5	Observations on the back side of the specimen Flames/Glowing Time ¹⁾	min:s	-	-	-		
6	Change of color Time ¹⁾	min:s	-	-	-		
7	Falling of burning droplets Start ¹⁾	min:s	no	no	no		
8	Extent Sporadic falling of burning droplets ²⁾		-	-	-		
9	Continuous falling of burning droplets ²⁾		-	-	-		
10	Falling of burning parts Start ¹⁾		no	no	no		
11	Sporadic falling of burning parts ²⁾		-	-	-		
12	Continuous falling of burning parts ²⁾		-	-	-		
13	Afterflame time at the bottom of the sieve (max.)	min:s	no	no	no		
	Impairment of the burner by dropping or falling material:		no	no	no		
14	Time ¹⁾	min:s	-	-	-		
15	Premature end of test: Final occurrence of burning at the specimen ¹⁾	min:s	0:45	0:40	0:40		
16	Time of eventually end of test ¹⁾	min:s	-	-	-		

¹⁾ indication of times: from the begin of testing procedure

³⁾ indication of carrier/foam layer separated in case of fire-proofing agents

²⁾ checked off if applicable

⁴⁾ very strong development of smoke

Investigation report No. 24/2792

page 4 of 9

"Brandschacht" tests (Part 2)

		Result with the tested specimen							
		Dim.	A	B	C	D	E		
	Afterflame after end of test		no	no	no				
17	Time	min:s	-	-	-				
18	Number of specimen		-	-	-				
19	Front side of specimen ²⁾		-	-	-				
20	Back side of specimen ²⁾		-	-	-				
21	Flame length	cm	-	-	-				
	Afterglow after end of test		no	no	no				
22	Time	min:s	-	-	-				
23	Number of specimen		-	-	-				
	Place of appearance		-	-	-				
24	Lower half of the specimen ²⁾		-	-	-				
25	Upper half of the specimen ²⁾		-	-	-				
26	Front side of specimen ²⁾		-	-	-				
27	Back side of specimen ²⁾		-	-	-				
28	Density of smoke ≤ 400% * min		34,10	67,32	41,30				
29	> 400% *min ⁴⁾		-	-	-				
30	Diagram: encl. No.		1	2	3				
	Residual lengths:								
31	Individual value ³⁾	cm	46 31	60 64	46 32	61 63	47 32	60 64	
32	Average value, individual test ³⁾	cm	50	51	51				
33	Photo of specimen in enclosure no.		1	2	3				
34	Flue gas temperature								
35	Maximum of average value	°C	115,3	120,4	118,4				
	Time ¹⁾	min:s	9:59	9:59	10:00				
36	Diagram: encl. No.		1	2	3				
37	Remarks: Fire shaft D is not applicable due to the residual length values (line 32) of fire shaft C								

¹⁾ indication of times: from the begin of testing procedure

²⁾ checked of if applicable

³⁾ indication of carrier/foam layer separated in case of fire-proofing agents

⁴⁾ very strong development of smoke

Special remarks: -

Investigation report No. 24/2792

page 5 of 9

Test results

1. Method: "Brandschacht" test accordance to DIN 4102 (1998-05)

"Brandschacht" tests (Part 1)

Arrangement of samples: freely suspended

Sample D	flaming side A in lenght direction	colour: 010	4 samples lenght side A
			Result with the tested specimen
		Dim.	D
1	Number of specimen arrangement acc. to. DIN 4102/T15 (1990-05), schedule 1		1
2	Maximum flame height above bottom edge of the specimen	cm	30
3	Time ¹⁾	min:s	0:08
4	Burn through / melting		
	Time ¹⁾	min:s	0:02
5	Observations on the back side of the specimen Flames/Glowing Time ¹⁾	min:s	-
6	Change of color Time ¹⁾	min:s	-
7	Falling of burning droplets Start ¹⁾	min:s	no
	Extent		-
8	Sporadic falling of burning droplets ²⁾		-
9	Continuous falling of burning droplets ²⁾		-
10	Falling of burning parts Start ¹⁾		no
11	Sporadic falling of burning parts ²⁾		-
12	Continuous falling of burning parts ²⁾		-
13	Afterflame time at the bottom of the sieve (max.)	min:s	no
	Impairment of the burner by dropping or falling material:		no
14	Time ¹⁾	min:s	-
15	Premature end of test: Final occurrence of burning at the specimen ¹⁾	min:s	0:40
16	Time of eventually end of test ¹⁾	min:s	-

¹⁾ indication of times: from the begin of testing procedure

²⁾ checked off if applicable

³⁾ indication of carrier/foam layer separated in case of fire-proofing agents

⁴⁾ very strong development of smoke

Investigation report No. 24/2792

page 6 of 9

"Brandschacht" tests (Part 2)

		Result with the tested specimen							
		Dim.	D						
	Afterflame after end of test		no						
17	Time	min:s	-						
18	Number of specimen		-						
19	Front side of specimen ²⁾		-						
20	Back side of specimen ²⁾		-						
21	Flame length	cm	-						
	Afterglow after end of test		no						
22	Time	min:s	-						
23	Number of specimen		-						
	Place of appearance		-						
24	Lower half of the specimen ²⁾		-						
25	Upper half of the specimen ²⁾		-						
26	Front side of specimen ²⁾		-						
27	Back side of specimen ²⁾		-						
28	Density of smoke ≤ 400% * min		53,91						
29	> 400% *min ⁴⁾		-						
30	Diagram: encl. No.		1						
	Residual lengths:								
31	Individual value ³⁾	cm	43 64 36 64						
32	Average value, individual test ³⁾	cm	52						
33	Photo of specimen in enclosure no.		1						
34	Flue gas temperature								
35	Maximum of average value	°C	122,9						
	Time ¹⁾	min:s	9:57						
36	Diagram: encl. No.		1						
37	Remarks: Fire shaft D is not applicable due to the residual length values (line 32) of fire shaft C								

¹⁾ indication of times: from the begin of testing procedure

²⁾ checked of if applicable

³⁾ indication of carrier/foam layer separated in case of fire-proofing agents

⁴⁾ very strong development of smoke

Special remarks: -

Investigation report No. 24/2792

page 7 of 9

2. Method: Fire behaviour of building materials and building components accordance DIN 4102-1 B2 (1998-05) - Test for normal flammability

3. Description of test material in condition as delivered: look at page 2

4. Preparation of samples:

Out of the material there have been cut samples for the ignitability apparatus. The samples were kept 14 days in climate chamber 20 +/- 2 °C and 65 +/- 4 humidity.

5. Arrangement of samples: freely suspended, flaming in length and cross direction / flaming side A and side B

6. Date of Test: 10.09.2024

Test results of normal flammability

„7485/300/0001“ Length	Dim.	edge-test						surface-test					
samples no.		1	2	3	4	5	6	1	2	3	4	5	6
flaming direction	A/B	A	A	A	B	B		A	B				
ignition ¹⁾	s	/	/	/	/	/		2	2				
reaching the mark of measurement ¹⁾²⁾	s	/	/	/	/	/		/	/				
max. flame height	cm	/	/	/	/	/		/	/				
time	s	/	/	/	/	/		/	/				
self cessation of the flames end of afterflame ¹⁾	s	/	/	/	/	/		2	2				
end of glowing ¹⁾	s	/	/	/	/	/		/	/				
flames were extinguished after ¹⁾	s	/	/	/	/	/		/	/				
smoke development (visual)		very low						very low					
dropping of burning material during 20s ¹⁾	s	/	/	/	/	/		/	/				
appearance after test: burned out till max. width 2,0 cm height 10,0 cm													

„7485/300/0001“ Cross	Dim.	edge-test						surface-test					
samples no.		1	2	3	4	5	6	1	2	3	4	5	6
flaming direction	A/B	A	A	A	B	B		A	B				
ignition ¹⁾	s	/	/	/	/	/		/	2				
reaching the mark of measurement ¹⁾²⁾	s	/	/	/	/	/		/	/				
max. flame height	cm	/	/	/	/	/		/	/				
time	s	/	/	/	/	/		/	/				
self cessation of the flames end of afterflame ¹⁾	s	/	/	/	/	/		/	2				
end of glowing ¹⁾	s	/	/	/	/	/		/	/				
flames were extinguished after ¹⁾	s	/	/	/	/	/		/	/				
smoke development (visual)		very low						very low					
dropping of burning material during 20s ¹⁾	s	/	/	/	/	/		/	/				
appearance after test: burned out till max. width 2,0 cm height 7,5 cm													

1) time mentioned from the beginning of the test

2) during 20 Sec

-/- no appearance

- no information

7. Remarks and explanations to the testing procedure: -none-

8. Opinion concerning the dropping of burning material:

The material shows no dripping burning material.

Investigation report No. 24/2792

page 8 of 9

9. Method: Fire behaviour of building materials and building components accordance DIN 4102-1 B2 (1998-05) - Test for normal flammability

10. Description of test material in condition as delivered: look at page 2

11. Preparation of samples:

Out of the material there have been cut samples for the ignitability apparatus. The samples were kept 14 days in climate chamber 20 +/- 2 °C and 65 +/- 4 humidity.

12. Arrangement of samples: freely suspended, flaming in length and cross direction/flaming side A and side B

13. Date of Test: 10.09.2024

Test results of normal flammability

„7485/300/0010“ Length	Dim.	edge-test						surface-test					
samples no.		1	2	3	4	5	6	1	2	3	4	5	6
flaming direction	A/B	A	A	A	B	B		A	B				
ignition ¹⁾	s	/	/	/	/	/		2	1				
reaching the mark of measurement ¹⁾²⁾	s	/	/	/	/	/		/	/				
max. flame height	cm	/	/	/	/	/		/	/				
time	s	/	/	/	/	/		/	/				
self cessation of the flames end of afterflame ¹⁾	s	/	/	/	/	/		3	2				
end of glowing ¹⁾	s	/	/	/	/	/		/	/				
flames were extinguished after ¹⁾	s	/	/	/	/	/		/	/				
smoke development (visual)		very low						very low					
dropping of burning material during 20s ¹⁾	s	/	/	/	/	/		/	/				
appearance after test: burned out till max. width 2,0 cm height 7,5 cm													

„7485/300/0010“ Cross	Dim.	edge-test						surface-test					
samples no.		1	2	3	4	5	6	1	2	3	4	5	6
flaming direction	A/B	A	A	A	B	B		A	B				
ignition ¹⁾	s	/	/	/	/	/		2	2				
reaching the mark of measurement ¹⁾²⁾	s	/	/	/	/	/		/	/				
max. flame height	cm	/	/	/	/	/		/	/				
time	s	/	/	/	/	/		/	/				
self cessation of the flames end of afterflame ¹⁾	s	/	/	/	/	/		2	3				
end of glowing ¹⁾	s	/	/	/	/	/		/	/				
flames were extinguished after ¹⁾	s	/	/	/	/	/		/	/				
smoke development (visual)		very low						very low					
dropping of burning material during 20s ¹⁾	s	/	/	/	/	/		/	/				
appearance after test: burned out till max. width 2,5 cm height 8,0 cm													

1) time mentioned from the beginning of the test

2) during 20 Sec

-/- no appearance

- no information

7. Remarks and explanations to the testing procedure: -none-

8. Opinion concerning the dropping of burning material:

The material shows no dripping burning material

Investigation report No. 24/2792

page 9 of 9

Test results

According to the test results of page 2-6 the material fulfils the requirements of building materials class B1 and B2 according to DIN 4102-1.

The present test samples (see page 2) can be classified according to the **DIN 4102 part1 (1998-05)** into the following class:

Baustoffklasse B1
(schwerentflammbare Baustoffe - hardly flammable)

Results: The examined product meets the requirements of class B1 for „schwerentflammbare“ (hardly flammable) building materials according to DIN 4102, part 1 (1998-05), suspended freely or with distance of >40 mm to same or other plain materials.

Special remarks:

- This report is only valid for the material as described under paragraph 1 (see page 2). In combination with other materials or with additional coatings or grounds etc. the burning behaviour may differ.
- This test report is not valid for the exposure to outdoor climate conditions.
- This test report is not valid, as soon as the fabric is used as a building product in the sense of the „Landesbauordnungen“ (state building requirements, MBO §17, par. 3).
- This test report is no substitute for a General Building Inspectorate Certificate.
- This test report is granted without prejudice to the rights of third parties, in particular private proprietary rights.
- For legal interests only the German original version is relevant.
- In General Building Inspectorates procedures this test report can be based for
 - o regular building materials for the required proof of accordance
 - o for not regular building materials for the required proof of applicability
- To noted is the notes in appendix D (DIN 4102-1)
- If the above-mentioned building materials is not used as product according to MBO § 2, Abs. 9, Ziffer 1,
- there is not need for a general building supervisory test report.
- This test report not replace an eventually necessary proof of applicability concerning building supervisory or building laws in the meaning of state building prescription. This has to be verified by:
 - o „allgemeine bauaufsichtliche Zulassung“ (general building inspectorate approval) or by
 - o „allgemeine bauaufsichtliches Prüfzeugnis“ (general building inspectorate certificate) or by
 - o „Zustimmung im Einzelfall“ (exceptional approval)
- This test report can underlie building supervisory procedures:
 - o For regular building products for the pre scribed proofs of conformity
 - o For non-regular building products for the needed proofs of applicability

Validity:

This test report is valid until 31.08.2029, assuming that the test methods, the classification rules and the technology do not change during this period.

This test report is no substitute for a General Building Inspectorate Certificate.



i.A. Dragana Vinc
Labor/Laboratory

DELCOTEX Delius Techtex GmbH & Co. KG

Only the information contained in the signed test report is binding.

Investigation report No. 24/2792

Attachment 1

Sample: A

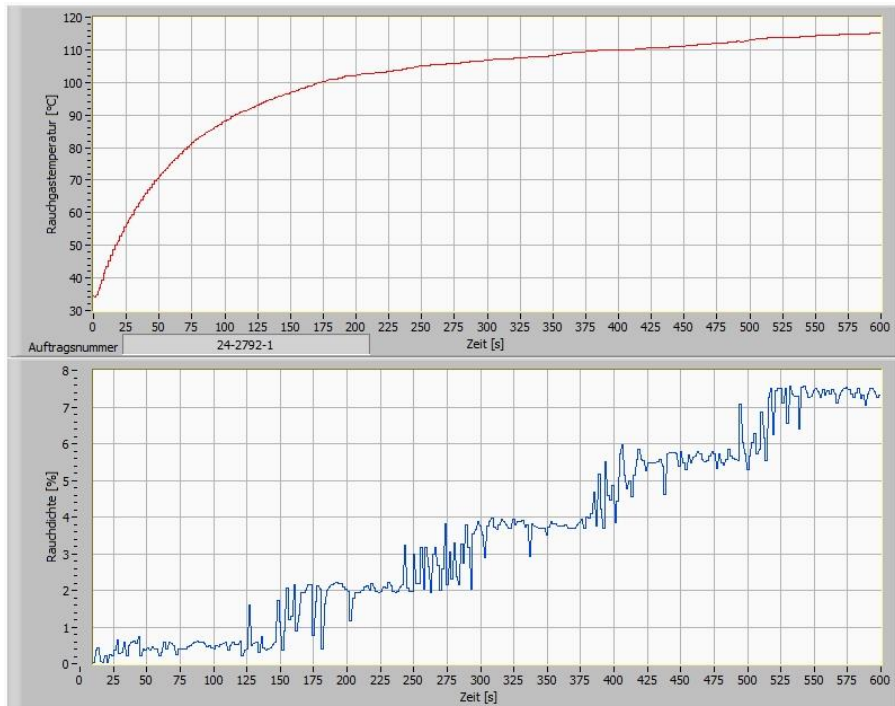


fig 1: Graphs of the flue gas temperature and the smoke density



fig 2: Photo of test specimen after the test

Investigation report No. 24/2792

Attachment 2

Sample: B

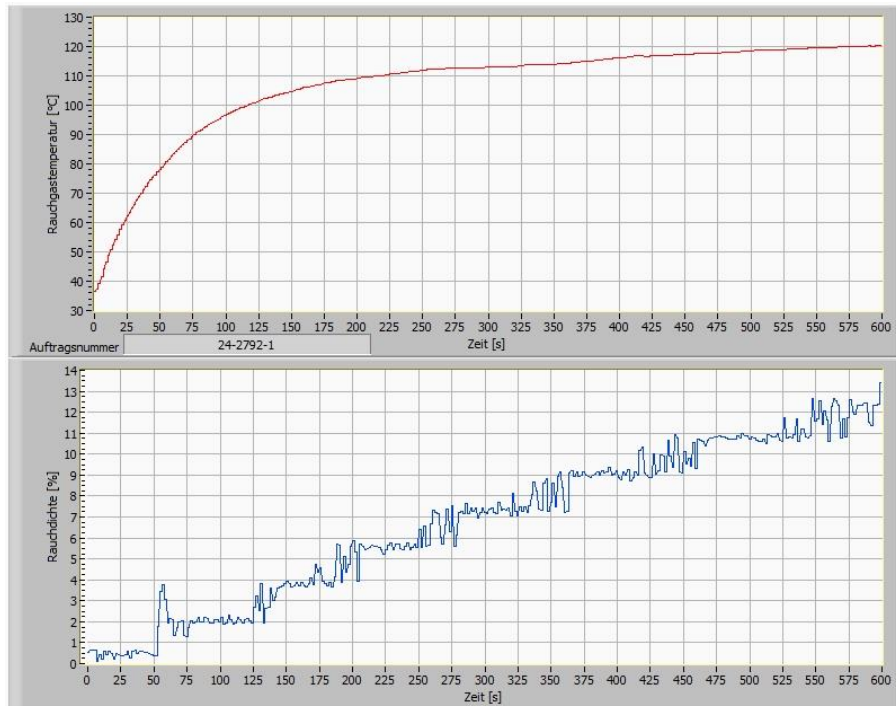


fig 1: Graphs of the flue gas temperature and the smoke density



fig 2: Photo of test specimen after the test

Investigation report No. 24/2792

Attachment 3

Sample: C

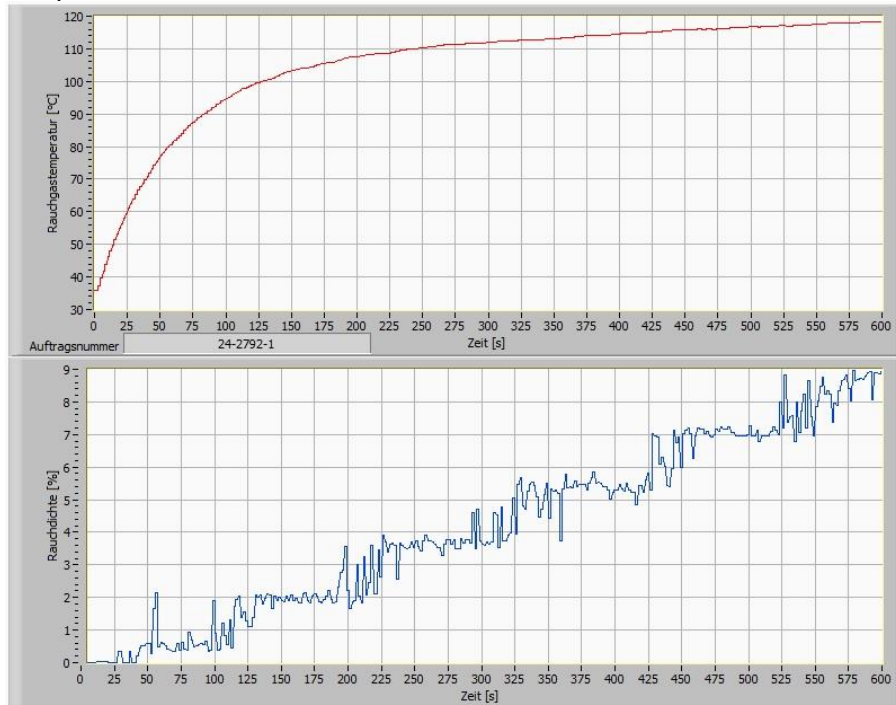


fig 1: Graphs of the flue gas temperature and the smoke density



fig 2: Photo of test specimen after the test

Investigation report No. 24/2792

Attachment 4

Sample: D

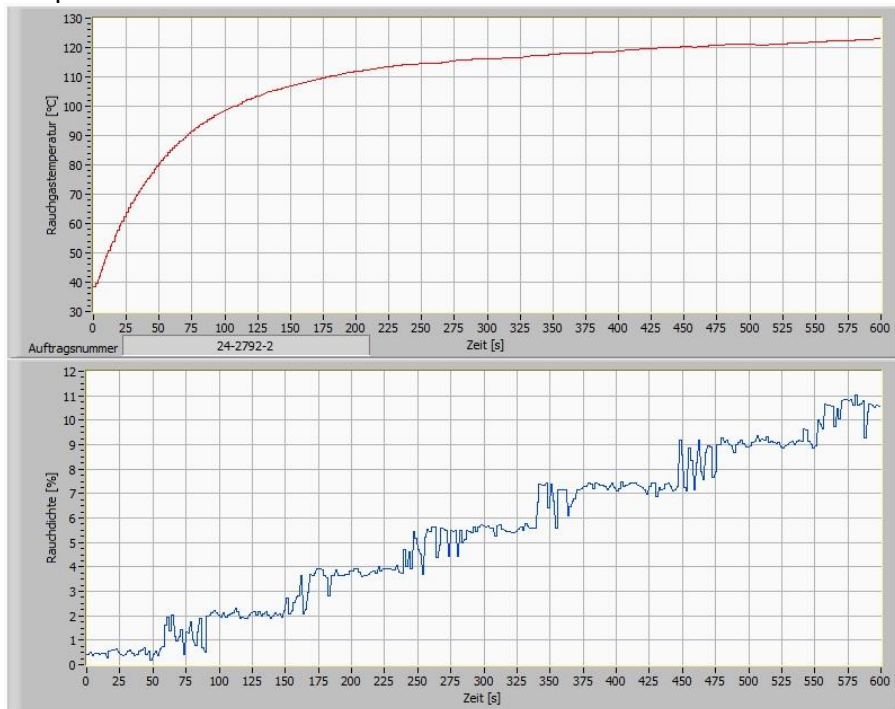


fig 1: Graphs of the flue gas temperature and the smoke density



Bild 2: Aussehen der Proben nach dem Brandversuch